

## 2018 Dodge or Ram Truck RAM 3500 Truck 4WD L6-6.7L DSL Turbo

MIL ON with LOW Coolant Message in Cluster

TECH-ASSIST

04/03/2020 | 11:42:57

MIL ON with LOW Coolant Message in Cluster.

P2560 - Engine Coolant Level Low

Replaced the sensor In the bottom of the reservoir. Still has the message on in the Info Center and has code.

Disconnect the sensor and jumper the connector ends and the code and message go away.

### Mileage

None Indicated

### Symptoms

MIL/Warning Indicator Lamp  
On

### Test Performed

None Indicated

### Systems

Cooling Systems

### DTC Codes

P2560

### Keywords

None Indicated

Comment(1)

The sensor in the coolant reservoir uses a magnetic strip and sludge can insulate it from picking up the signal. Removing the reservoir and trying to clean it out thoroughly may help, if not the reservoir needs replacement.

TECH-ASSIST

04/03/2020 | 07:44:04

## 1 Repair(s) Available

### Verified Repair(2)

TECH-ASSIST

04/03/2020 | 11:46:51

Unable to access all of the internals of the reservoir, so replacement of the reservoir with a new OEM unit resolved the issue.

The diagram and OEM troubleshooting don't account for a reservoir issue.

Comment(0)

