

1989 Dodge or Ram Truck Dakota 2WD V6-239 3.9L VIN X FI

Vehicle > ALL Diagnostic Trouble Codes (DTC) > Testing and Inspection > Manufacturer Code Charts > Driveability (DR) Tests

DR-38 CHECKING SECONDARY IGNITION SYSTEM

Perform Driveability Test 37, before proceeding.

1. Connect an engine analyzer to engine, then start engine and let engine stabilize for two minutes.
2. Set equipment for secondary ignition testing and analysis, then check ignition coil output.
3. If secondary pattern is satisfactory and open circuit secondary volts are at least 25KV, proceed to Test 39.
4. If secondary pattern is not satisfactory or open circuit secondary volts are not at least 25KV, repair indicated component in secondary ignition system, then proceed to Test 45.