

REFERENCE:	TSB: 23-074-23 GROUP 23 - Body	Date:	June 21, 2023	REVISION:	–
VEHICLES AFFECTED:	2019 - 2021 (DT) RAM 1500 Pickup This bulletin applies to all vehicles built on or after October 01, 2017 (MDH 1001XX) and prior to December 31, 2020 (MDH 1231XX) equipped with a Cargo And CHMSL Lamp (Sales Code LPE).			MARKET APPLICABILITY: <div><input checked="" type="checkbox"/> NA<input type="checkbox"/> CH</div> <div><input checked="" type="checkbox"/> EE<input checked="" type="checkbox"/> IAP</div> <div><input checked="" type="checkbox"/> SA<input checked="" type="checkbox"/> MEA</div>	
CUSTOMER SYMPTOM:	Customers may experience one or more of the following: <ul style="list-style-type: none"><li>• Water on the headliner.</li><li>• Water at the back of the cab.</li><li>• A leak from the third brake/cargo light/CHMSL.</li></ul>				
CAUSE:	Degradation of the gasket material.				

**REPAIR SUMMARY:**

This bulletin involves replacing the CHMSL assembly.

**CLAIMS DATA:**

Labor Operation No:	Labor Description	Skill Category	Labor Time
08-50-88-93	Lamp, Center High Mounted Stop Replace (0 - Introduction)	6 - Electrical and Body Systems	0.3 Hrs.
Failure Code	ZZ	Service Action	

**SPARE PARTS:**

Qty	Part No.	Description	Notes
1	68298380AH	Lamp Center High Mounted Stop	Bulb CHMSL

**DIAGNOSIS:**

If the customer describes any of the symptom listed above in the customer symptom section, perform the Repair Procedure.

**REPAIR PROCEDURE:**

1. Replace the CHMSL assembly. Refer to the detailed service procedures available in DealerCONNECT> Service Library under: Service Info>08 Electrical / 8L Lamps and Lighting / Lamps/Lighting Exterior / Lamp, Center High Mounted Stop / Removal and Installation.

**NOTE: Ensure the interior is dry before returning the vehicle to the customer.**

**POLICY:**

Vehicles included in this Technical Service Bulletin have a warranty extension to an 10 Year/150,000 miles from in service date warranty period for this repair. See Warranty Bulletins: U.S. D-23-11, Canada SAB 2023-17, International ID-23-14, Puerto Rico/U.S. Virgin Islands ID-23-13 and Mexico BG-02-23, for details associated with the Warranty Extension.

*This bulletin is supplied as technical information only and is not an authorization for repair. No part of this publication may be reproduced, stored in a retrieval system, or transmitted, in any form or by any means, electronic, mechanical, photocopying, or otherwise, without written permission of FCA US LLC.*